




TC-400-NF-PM-X
3190-2805


Type N Female (Jack) Panel Mounting
Solder Pin Connector for LMR-400 Cable

Made in China


Installation Instruction

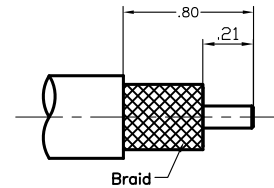


1. A. Trim cable to dimensions shown. Be careful to avoid nicking the braid
- B. Remove any residual plastic from center conductor
- C. Deburr center conductor using a fine file or Times DBT-U tools
- D. Avoid nicking aluminum tape or center conductor

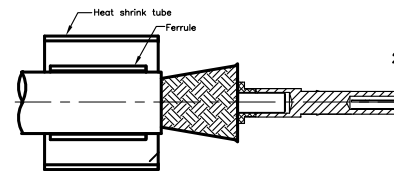

2. A. Put on the soldering insulator (Raised face towards forward)
- B. Solder the inner conductor. Slide crimp ferrule and heat shrink tube over the cable
- C. Flare the braid

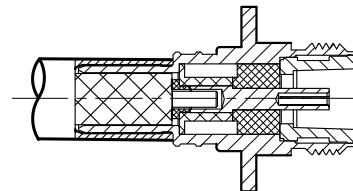

3. A. Insert Cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.

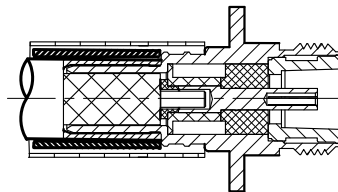

4. A. Slide crimp ferrule over braid and crimp as close to body as possible using .429" HEX crimp tooling
Pay attention to the crimp area, do not crimp rear of crimp sleeve
- B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun