

3 1 9 0 - 6 4 3 3


**EZ-200-BM-X**  
**3190-6433**

**BNC Male (Plug) Non-Solder Pin  
No Braid Trim Connector  
for LMR-200 Cable**




**YYWW**

Made in China

## Installation Instruction

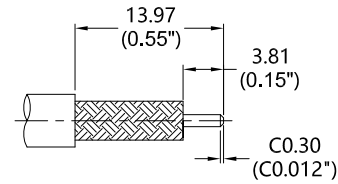

Dimensions in millimeters (inches)

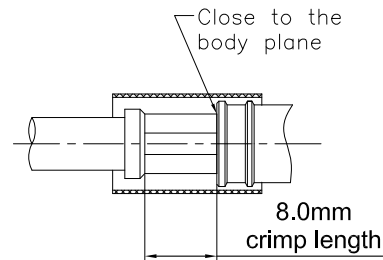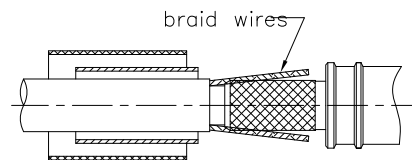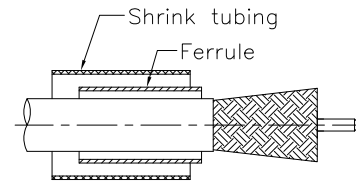

1. A. Cut the cable squarely while keeping it round using the CCT-02 cutting tool.  
B. Trim cable to dimensions shown using the CST-195/200 prep tool.  
C. Remove any residual plastic from the center conductor.  
D. Deburr center conductor using a fine file.

2. A. Slide shrink tubing, crimp ferrule over the cable as shown.  
B. Flare the braid.

3. A. Insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.  
B. all braid wires on outside of connector body

4. A. Slide the ferrule over braid and crimp as close to body as possible using .213" HEX crimp tooling, Pay attention to the crimp length, do not crimp rear of crimp sleeve  
B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun

Times supply rubber boot 3109-445(WSB-195/200) as an option to instead of heat shrink tube.

Refer to [www.timesmicrowave.com](http://www.timesmicrowave.com) for install videos