



# TIMES MICROWAVE SYSTEMS

## INSTALLATION INSTRUCTIONS

358 Hall Avenue/P.O. Box 5039  
Wallingford, CT 06492-5039  
Tel: 203-949-8400  
FAX: 203-949-8423  
1-800-TMS-COAX  
www.timesmicrowave.com


TC-400-NM (3190-552;-759)

Cable Types: LMR-400; 400-DB; 400-FR; 400-Ultraflex; 400-LLPL)

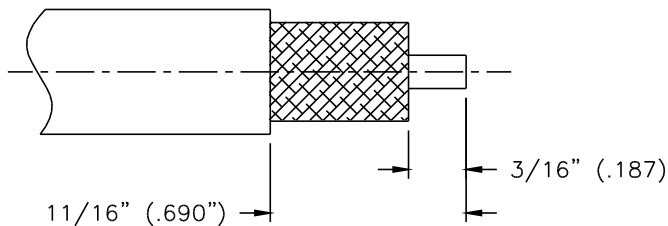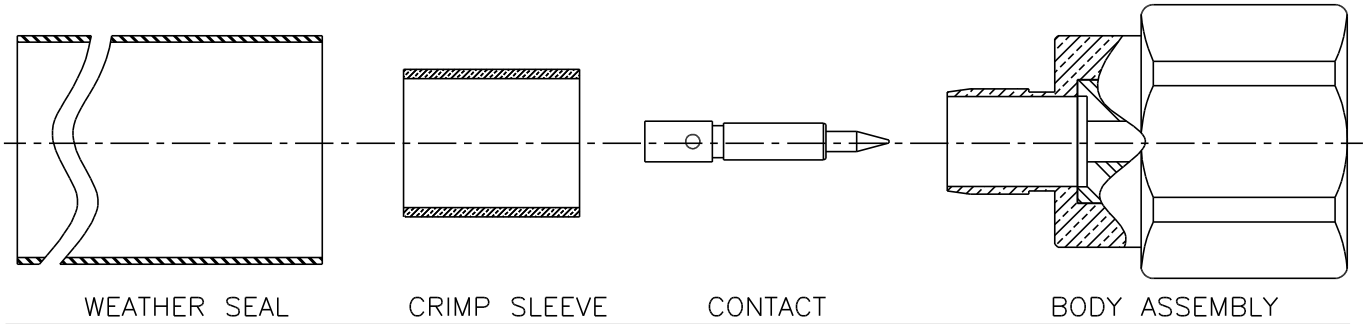


1.A. Trim cable per dimensions shown using a razor knife or times ST-400-EZ strip tool.

B. Remove any residual plastic from the center conductor and debur center conductor using a fine file or Times DBT-01 tool.

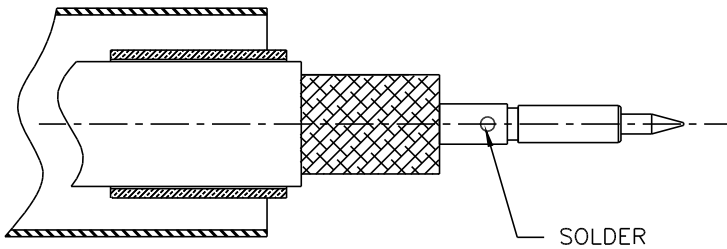

2.A. Solder contact to center conductor, making sure back end of contact is flush with trimmed end of cable dielectric. Use minimal heat to minimize melting of foam dielectric. Inspect to be sure aluminum foil is not touching center contact.

B. Slide crimp sleeve and weather seal over cable.

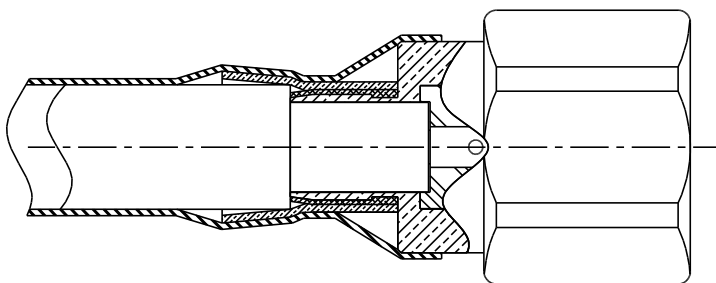

3.A. Insert cable into connector until fully seated, with all braid wires on the outside of connector body and aluminum tape inside connector body.

B. Slide crimp sleeve forward and crimp as close as possible to body using a .429" hex die. Use Times HX-4 crimp tool or equivalent. Do not crimp rear of crimp sleeve.

C. Heat shrink weather seal over rear of connector body and down onto cable jacket using hot air gun.