




TC-500-NMH-X
3190-2514


Type N male(plug) straight solder
pin connector for LMR-500 cable

Made in China


Installation Instruction

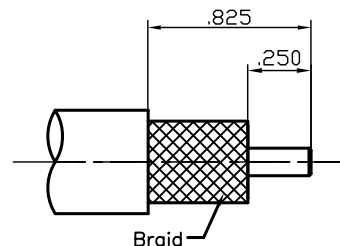


1. A. Trim cable to dimensions shown. Be careful to avoid nicking the braid
B. Remove any residual plastic from center conductor
C. Deburr center conductor using a fine file or Times CST-500 tools
D. Avoid nicking aluminum tape or center conductor

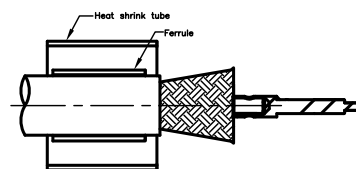

2. A. Solder the contact pin and inner conductor of cable
B. Slide crimp ferrule and heat shrink tube over the cable
C. Flare the braid

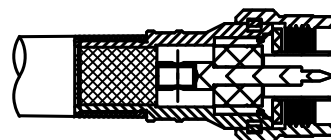

3. A. Insert Cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.

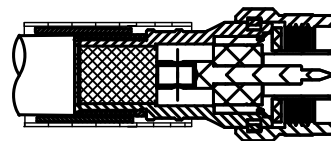

4. A. Slide crimp ferrule over braid and crimp as close to body as possible using .532" HEX crimp tooling. Pay attention to the crimp area, do not crimp rear of crimp sleeve
B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun