


3 1 9 0 - 6 4 0 1

EZ-195-NF-BH-X
3190-6401





**Type N Female (Jack) Straight
Non-Solder Pin No Braid Trim
Connector for LMR-195 Cable**

Made in China

Installation Instruction

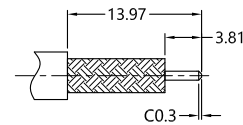

Dimensions in millimeters

 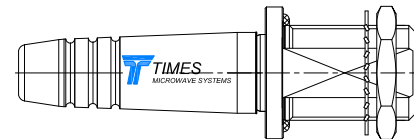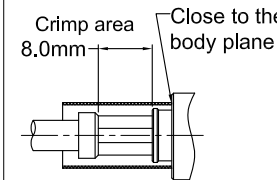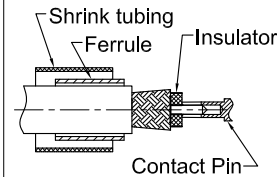

1. A. Trim cable to dimensions shown. Be careful to avoid nicking the braid
B. Remove any residual plastic from center conductor
2. A. Slide the shrink tubing, ferrule, insulator and contact pin over the cable as shown, make sure cable dielectric is abreast
B. Flare the braid
3. A. Insert cable into connector body until dielectric is seated with all braid wires on outside of connector body
4. A. Slide the ferrule over braid and crimp as close to body as possible using .213" HEX crimp tooling. Pay attention to the crimp area, do not crimp rear of crimp sleeve
B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun

Times supply rubber boot 3109-445 (WSB-195/200) as an option to instead of heat shrink tube.

Refer to www.timesmicrowave.com for install videos