

 
3 1 9 0 - 6 1 4 2

EZ-195-TM-RP-X
3190-6142

**TNC Male (Plug) Straight Non-Solder Pin
Connector for LMR-195 Cable**


Made in China

Installation Instruction




Dimensions in millimeters


1. A. Cut the cable squarely while keeping it round using the CCT-02 cutting tool.
- B. Trim cable to the dimensions shown using the CST-195/200 prep tool.
- C. Remove any residual plastic from the center conductor.
- D. Debur center conductor using a fine file.

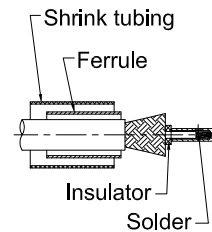

2. A. Slide ferrule, shrink tubing and insulator over the cable as shown. Make sure cable dielectric is abreast.
- B. Solder the contact pin and inner conductor of cable. Control the solder times. Clean solder area if necessary.
- C. Flare the braid.

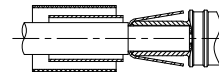

3. A. Insert cable into connector body until dielectric is seated with all braid wires on outside of connector body.

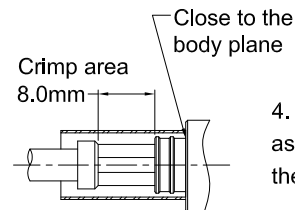

4. A. Slide the ferrule over braid and crimp as close to body as possible using .213" HEX crimp tooling. Pay attention to the crimp area, do not crimp rear of crimp sleeve.
- B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun.

Refer to www.timesmicrowave.com for install videos