


3 1 9 0 - 6 4 1 0

EZ-600-FM-75-X
3190-6410


**F Male (Plug) Straight Non-Solder Pin
No Braid Trim Connector for
LMR-600-75 Cable**

Made in China


Installation Instruction

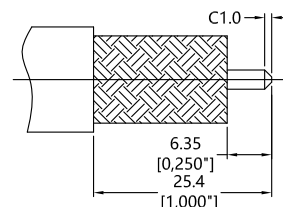


All dimensions in millimeters

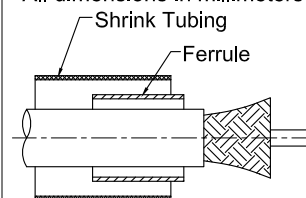

1. A. Trim cable to dimensions shown.
Be careful to avoid nicking the braid
- B. Remove any residual plastic from center conductor
- C. Deburr center conductor using a fine file or Times DBT-U tools

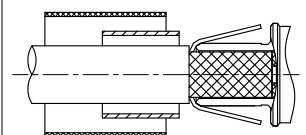

2. A. Slide crimp ferrule and heat shrink tubing over the cable
- B. Flare the braid

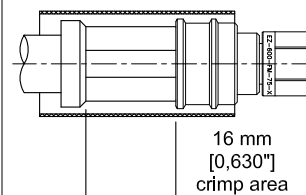

3. A. Insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.

4. A. Slide crimp ferrule over braid and crimp as close to body as possible using .610" HEX crimp tooling
Pay attention to the crimp area, do not crimp rear of crimp sleeve
- B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun



Times supply rubber boot 3109-401 (WSB-600) as an option to instead of heat shrink tube.

Refer to www.timesmicrowave.com for install videos